


DATE August 19, 1982

YZ125J ROTOR PULLER MODIFICATION

The rotor pullers for the YZ125J, including those in the owner's tool kit, do not fit properly. Because the end of the crankshaft is lengthened, the puller does not adequately engage the threads in the rotor; when the puller is tightened, threads in the rotor may be pulled out of the rotor.

To correct this problem, Kent-Moore has modified their stock of pullers. The pullers have been remachined as shown in the illustration.

NOTE: The remachined pullers will still work on all other applicable models.

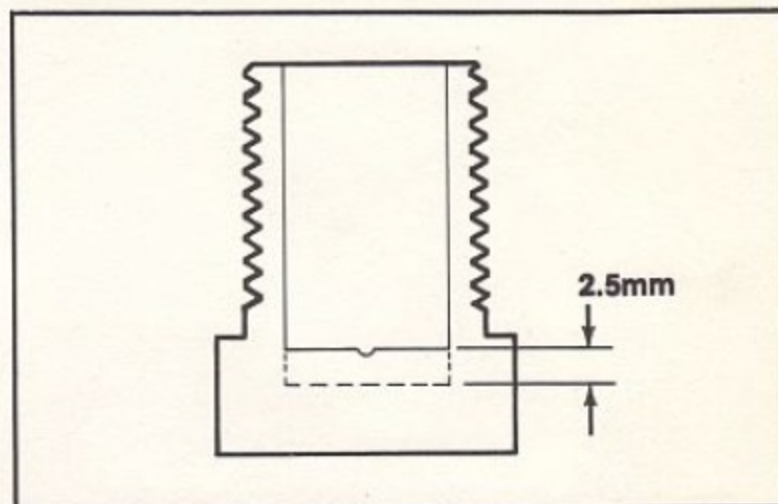

Note that the bottom of the hole has been machined flat; this must be done to avoid damage to the crankshaft.

PARTS INFORMATION

PART NUMBER	DESCRIPTION	REMARKS	DEALER COST
YM-55500-A	YZ125J Rotor puller	Remachined	\$3.75

SERVICE COPY	SER MGR	MECH	MECH	MECH	BINDER
OFFICE COPY	GEN MGR	SALES	PARTS	BINDER	PAGE 1 OF 1