




The chain guide on some of the affected models is not properly aligned with the chain. As a result of this misalignment, the chain hits the guide and falls off the driven sprocket during operation. To avoid this problem, inspect the chain guide on each affected model during predelivery. If the guide is not properly aligned with the chain, carefully bend the chain guide bracket until the chain runs through the middle of the guide.

## AFFECTED MODELS

All YZ125H

## **PROCEDURE**

 Rap the chain guide with a plastic mallet, and bend the chain guide bracket towards the frame. Apply the minimal force needed to bend the chain guide in line with the chain. Be sure the chain runs through the middle of the chain guide as shown in the photograph.

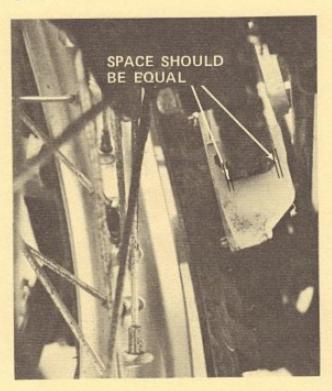

Instruct your customers to inspect the chain guide after each race. Rocks or other debris can bend the chain guide.

SERVICE COPY	SER MGR	MECH	MECH	MECH	BINDER
OFFICE COPY	GEN MGR	SALES	PARTS	BINDER	PAGE 1 OF 1